



# SERVICE BULLETIN



Bulletin No.  
Date  
Page

75-6  
May 2, 1975

SUBJECT: FRONT FORKS  
Affected Models: GT380M, GT550M and GT750M  
Effective Engine No.:  
Reference:

Read & Initial

Manager  
Parts  
Service

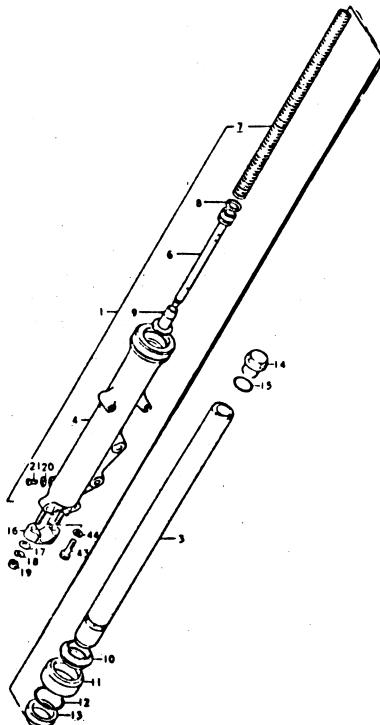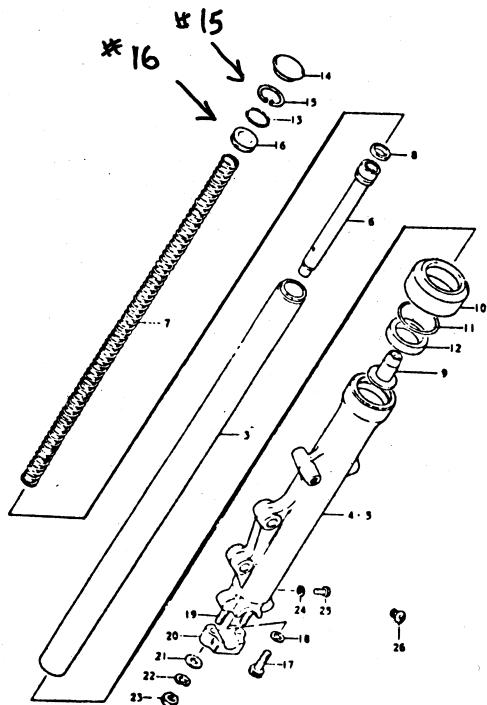

1975

EARLIER MODELS

NOTICE:

The 1975 GT series triples have slightly different front forks from those used on earlier models.

The most noticeable difference is that there is no stanchion tube cap bolt, the spring being secured instead by a machined plug (#16) held in place by a circlip (#15). Care should be taken when changing the fork oil in these units that the circlip be reinstalled properly and that it be replaced should it become bent or twisted whilst being removed. The correct oil levels for the 74 and 75 front fork assemblies can be found in bulletins #74-6 and 74-13.

*C. Knight*  
C. Knight  
Service Manager