



# SUZUKI

## 2-Stroke


# Service Bulletin

Subject: T500 SWING ARM PIVOT SHAFT  
REFERENCE: Service Bulletin #TC/TS-17

Bulletin No: T-4  
Date: Oct. 24, 1975  
Read and Initial  
Manager: \_\_\_\_\_  
Parts: \_\_\_\_\_  
Service: *AWP*


### NOTICE:

The shoulder radius of the T500 swing arm pivot shaft has been increased from 0.5mm to 1.0mm.

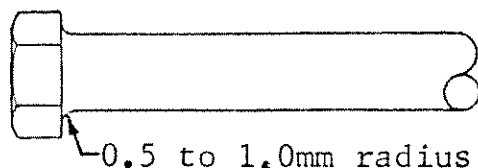

To accept the new type pivot shaft, the frame boss chamfer has also been increased 0.5mm.

NOTE: Should it be necessary to install a new type pivot shaft through an old type frame boss, simply move the washer from the nut side to the head side of the swing arm pivot shaft. The washer will conform to the shoulder radius of the pivot shaft.

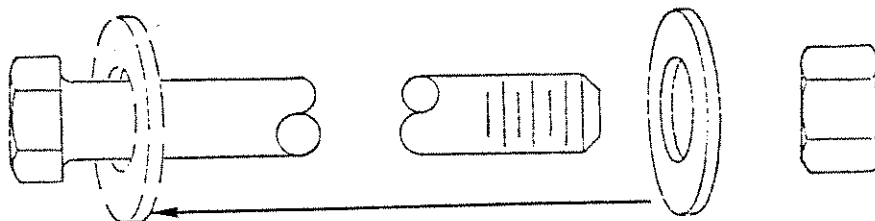

### PARTS:

The new type pivot shaft is now available from U. S. Suzuki's Parts Department. The part number is listed below:

### DESCRIPTION

### PART NUMBER

T500 swing arm pivot shaft

61211-15006

### APPLICATION:

The new type swing arm pivot shaft has been installed on and from the following Frame Number:

T500-84046